

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT

We make Indiana a cleaner, healthier place to live

Frank O'Bannon
Governor

Michael O'Connor
Commissioner

100 North Senate Avenue
P.O. Box 6015
Indianapolis, Indiana 46206-6015
Telephone 317-232-8603
Environmental Helpline 1-800-451-6027

January 28, 1997

VIA CERTIFIED MAIL Z 339 776 538

Robert Feddeler
180501 Clark Road
Lowell, Indiana 46356

Dear Mr. Feddeler:

RE: Violations of 329 IAC 10 and IC 13-30
Feddeler Landfill, R & M Enterprises, Inc.
Lake County

On December 9, 1996 and January 6, 1997, Robert Lamprecht, of this office, conducted inspections of the above-referenced Construction/Demolition Site. The inspections revealed the following violations of Rule 329 IAC 10 and the Environmental Management Act, IC 13-30 (formerly IC 13-7):

10-36-4 (c) Sanitation - Windblown materials and litter must be collected and buried daily. Windblown materials must be controlled by effective means so that they do not constitute or contribute to a nuisance.

10-36-14(a) Grading and Soil Stabilization - Cover material applied as required in sections 11 through 13 of this rule and 329 IAC 10-37 must be continuously maintained, including application and compaction of additional cover as needed to maintain required depth.

10-36-15(a) Surface Leachate Control - Any leachate on the surface of a restricted waste Type III and a construction/demolition site must be immediately managed to prevent off-site migration.

10-13-4(c) Effect of Permit Issuance - The permittee shall construct and operate a solid waste land disposal facility in accordance with the permit. The owner, operator, and permittee are equally responsible for complying with the conditions of the permit, the regulations, and the statutes. Permit violations were as follows:

Violation of the June 13, 1995 Permit, Condition A6 - Municipal solid waste as defined in 50 CFR 257 and 258 shall not be accepted at this facility. Only construction/demolition waste and tested, industrial process scrap insulation materials waste from Globe Industries shall be disposed of at the site. The limits of the disposal area are delineated on the map revision, untitled, dated May 5, 1981.

Mr. Robert Feddeler

January 28, 1997

Page 2


Violation of the June 13, 1995 Permit, Condition A5 and 329 IAC 10-35-2(b)(1), Boundary Markers - Permanent, visible boundary markers which delineate the approved facility and solid waste boundaries shall be maintained for the life of the facility.

In addition 329 IAC 10-36-15(b) states that any surface movement of leachate past a point fifty (50) feet outside of the solid waste boundary is prohibited except as specified in the facility permit. Due to the absence of boundary markers Mr. Lamprecht could not determine if leachate was present fifty (50) feet outside of the solid waste boundary.

As indicated in the January 6, 1997 inspection report, the boundary markers must be in place within sixty (60) days or receipt of this letter. All other violations must be corrected immediately. Follow-up inspections will be conducted to determine compliance. Failure to correct the violations may subject you to enforcement and the imposition of penalties of up to \$25,000 per day per violation. Compliance with this letter does not preclude this office from taking an enforcement action for the violations noted.

I received a letter from Mr. Joseph Scodro outlining R & M Enterprises, Inc.'s response to the violations noted. If you and/or Mr. Scodro would like to meet with me to discuss the violations, please contact me at 317/232-4546. If you would like to speak with Mr. Lamprecht, he can be reached at 219/881-6741.

Sincerely,

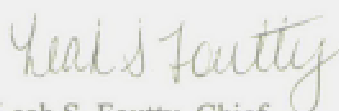

Leah S. Foutty, Chief
Solid Waste Compliance Section
Solid and Hazardous Waste Management

LSF/RL:cf

Enclosure

cc: Lake County Health Department
Lake Solid Waste Management District
Joseph Scodro

Mr. Robert Feddeler

January 28, 1997

Page 3

bcc: Public file 2B2

data entry

Robert Lamprecht solid waste inspector

Jeff Sewell, permit manager

Brian Wagner

Leah Foutty

George Kooistra

RR 13, Box 275

Brazil, IN 47834

*also, please route copy
to Jennifer Thompson (OLC)*

Enclosure needed for addressee:

inspection report(s)

Enclosures needed for carbon copies and blind carbon copies:

inspection report(s)

Joe Scodro's address:

Bingham Summers Welsh & Spilman

2700 Market Tower

10 West Market Street

Indianapolis, IN 46204-2982

Public File Addler L.F. Lake Compliance File

**BINGHAM SUMMERS
WELSH & SPILMAN**

Attorneys at Law

Joseph M. Scodro

January 16, 1997

Leah Foutty
Chief - Solid Waste Compliance Section
Indiana Department of Environmental Management
100 North Senate, 11th Floor
P.O. Box 6015
Indianapolis, IN 46206

OFFICE OF SOLID
AND HAZARDOUS
WASTE MGMT
DEM

JAN 21 2 27 PM '97

Dear Ms. Foutty:

Pursuant to our recent discussions, please accept this as the response of R & M Enterprises, Inc. (hereafter "R & M") to the various items contained in Mr. Robert Lamprecht's January 6, 1997, Solid Waste Compliance - Inspection Report and Comments related to the R & M's construction and demolition landfill located at 10100 181st Street, Lowell, Indiana.

At the outset, I would point out that Mr. Lamprecht's January 6, 1997, report indicates that he visited the R & M landfill on December 9, 1996, and then again on an unspecified date in January, 1997. We are unable to determine the date of Mr. Lamprecht's subsequent inspection inasmuch as no written report of that inspection was provided to my clients for review or counter-signature.

Nevertheless, please allow this letter to stand as R & M's response to each of the items contained in Mr. Lamprecht's January 6, 1997, report.

December 9, 1996

- 10-36-4(c) - Sanitation, Litter. Mr. Lamprecht's report indicates that wind-blown paper and plastic bags were found along the east property fenceline. Please be advised that R & M manually removes litter and debris from all fence areas, during and at the end of each day. R & M hires temporary workers from the local high school to supplement this effort on windy days. The plastic bags to which Mr. Lamprecht refers were being used to collect the wind-blown paper as the collection of the wind-blown paper was in process. The plastic bags were full and partially full. These bags were removed as part of R & M's regular garbage collection service with Allied Waste.

Indianapolis Office

2700 Market Tower • 10 West Market Street
Indianapolis, Indiana 46204-2982
(317) 635-8900 • Fax: (317) 236-9907

Bloomington Office

645 North Walnut Street • P.O. Box 2358
Bloomington, Indiana 47402-2358
(812) 332-4577 • Fax: (812) 332-4774

**BINGHAM SUMMERS
WELSH & SPILMAN**

Attorneys at Law

Leah Foutty
January 16, 1997
Page 2

- 10-36-14(a) - Grading & Soil Stabilization, West Slope. R & M addresses grading and soil stabilization issues on an ongoing basis. Operators employed by R & M consistently work to maintain erosion control. On bad weather days, heavy equipment needed for correction of erosion control and soil stabilization can exacerbate the problem. Therefore, one or two day delays during inclement weather situations can be necessary. It is important to point out that Mr. Lamprecht acknowledges in his report that grading and soil stabilization efforts were ongoing and that he specifically noted that the issues identified during his December inspection were being addressed at the time of his January visit.
- 10-36-10(a) - Diversion of Surface Water. In this regard, it is important to note that closed cells do tend to settle and pooling does occur. These issues are addressed on an ongoing basis. In fact, it is our understanding based upon my recent conversations with Mr. Lamprecht that this issue noted during his December visit was immediately and satisfactorily addressed the same day following a conversation between Mr. Lamprecht and Mr. Feddeler.

January 6, 1997

- 10-36-4(c) - Sanitation, Litter. As noted above, the date of Mr. Lamprecht's second inspection is unknown. Nonetheless, as noted above, if wind-blown paper and plastic bags were observed at the time of the second inspection, it is because sanitation and litter collection efforts were ongoing at that time.
- 10-36-14(a) - Grading & Soil Stabilization, West Slope. As is addressed above, Mr. Lamprecht specifically noted during his January visit that grading and soil stabilization efforts were found along the southwest slopes of the landfill in an effort to correct the issues identified by him during his December visit. Although it is less than clear from his January 6, 1997, report, Mr. Lamprecht indicated to me during a recent telephone conversation that the referenced 200 yard x 30 yard area and the additional 200 yards to the north were in the process of being regraded at the time of his second visit.

BINGHAM SUMMERS
WELSH & SPILMAN

Attorneys at Law

Leah Foutty
January 16, 1997
Page 3

- 10-36-15(a) - Surface Leachate Control. With respect to the west side, the leachate ponds have been controlled and regraded. With respect to the east side, as I informed you, the landfill's neighbor to the east recently filed a quiet title lawsuit which has placed at issue the exact location of the east side boundary and property line. The lawsuit filed by Mr. Kooistra has complicated access to the east boundary area. We have been attempting to work with Mr. Kooistra in an attempt to resolve this issue, and those efforts are ongoing. In the course of discussions with Mr. Kooistra's attorney, R & M has looked to its surveyor consultant to verify a prior staked survey. That staked survey was completed in March, 1996, but the stakes were later removed by unknown persons without authority from R & M. We have informed Mr. Kooistra's attorney that the prior staked survey was correct, and interestingly, Mr. Kooistra's attorney has conceded for the sake of discussions that the prior staked survey is indeed correct. We have also informed Mr. Kooistra's attorney, and we do not believe there is any argument on this, that R & M has continually paid property taxes on its property up to and including the eastern boundary established in the March, 1996, staked survey. Therefore, it is our understanding that the only theory upon which Mr. Kooistra claims title to the strip of property in question is that of adverse possession. As noted above, discussions are ongoing in an attempt to resolve this issue. In the interim, however, R & M has agreed not to undertake any work along the disputed property line without the permission of Mr. Kooistra. Obviously, Mr. Kooistra's failure to provide permission could prevent R & M from addressing a leachate pooling issue along the eastern boundary line. However, the operator is making ongoing attempts to address leachate along the east boundary which is somewhat limited by the terms of the agreement with Mr. Kooistra. We would be happy to hear from IDEM with regard to any ideas it may have concerning this issue including any specific guidance IDEM may have concerning leachate control.
- 10-36-15(b) - Leachate Control. Please be advised that the source of the leachate leak on the southwest side was patched to control the leak. Mr. Lamprecht's January 6, 1997, report specifically indicates that he was unable to determine whether any of the leachate ponding extended beyond the R & M property

**BINGHAM SUMMERS
WELSH & SPILMAN**

Attorneys at Law

Leah Foutty
January 16, 1997
Page 4

line due to lack of property markers. As noted above, R & M retained a consultant to provide a staked survey in March, 1996, at a cost of \$1,420.00. Unfortunately, those stakes were later removed by unknown persons who had no authority to do so. Again, in light of the dispute with Mr. Kooistra, we would appreciate IDEM's guidance on how to address the issue of staking the disputed property line.

- 10-13-4(c). Mr. Lamprecht's January 6, 1997, report indicates that various unauthorized items of debris were being accepted at the landfill facility. Please be advised that materials that are accepted which are deemed inappropriate for fill are removed and sent back to the vendor for deposit at an MSW facility or directly sent to an appropriate facility at vendor's expense. White goods, rolled carpets and bedding noted in the inspection report have been segregated and either recycled or sent to an MSW landfill for final disposal. White goods are simply not filled at the landfill since they can be resold on a bulk basis. With respect to the rolled carpets that were brought to the landfill and which gave the appearance of having been disposed at the time of Mr. Lamprecht's visit, please be advised that the carpet in question rolled down the hill and gave the appearance of having been landfilled. The carpet was not landfilled. The carpet was collected and removed the same day. There is a pile of stumps and tree trunks that are stockpiled and removed on a periodic basis.
- 10-35-2(b)(1) - Property Boundary. As noted above, R & M retained a consultant to provide a staked survey which was completed in March, 1996, at a cost of \$1,420.00. However, the stakes were removed by persons unknown without the authority of R & M. Given the current property line dispute with Mr. Kooistra, any guidance IDEM can offer concerning marking the property boundary will be appreciated.
- 10-36-14(a)(b) - Grading and Soil Stabilization. Mr. Lamprecht's January 6, 1997, report indicates that tree balls, tree trunks and a large shaker box were situated on top of a closed cell which would prevent continuous maintenance and establishment of proper vegetation. To our knowledge, the shaker box in question was removed in November, 1996. The

BINGHAM SUMMERS
WELSH & SPILMAN

Attorneys at Law


Leah Foutty
January 16, 1997
Page 5

shaker box had been used to separate clean fill from brush and stumps. Tree balls, brush and trunks are stockpiled because they are shredded to be used as interim cover. R & M is currently in the process of attempting to retain a mobile shredder contractor to continue this operation. In any event, R & M has ceased acceptance of these materials due to the associated handling costs. R & M will not be placing any additional material of any kind on top of closed cells so that there is proper access to maintenance.

As I discussed, we would be happy to meet with you and other members of your office concerning the operation of the R & M Enterprises, Inc. construction and demolition facility and any of the issues referenced above. We appreciate your input and look forward to your continued technical advice and assistance.

We look forward to hearing from you.

Very truly yours,



Joseph M. Scodro

JMS:clw/265908

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 3

IN-IRCF-8-95

Date:	01/06/97	Time:	1:00Pm	County:	Lake
Facility:	Feddeler Landfill/ R & M Enterprises, Inc.				
Location:	18501 Clark Road Lovedl, Indiana 46356 219-696-8905				
Permit #	45-18 or Non-permitted <input type="checkbox"/>				
Inspected by:	Robert Lamprecht- <i>Robert Lamprecht</i>				
Comments:	<p>On today's date and time this inspector conducted a follow-up inspection to determine if violations found during a previous inspection conducted on 12/09/96, have been corrected. The following violations were documented at Feddeler/R&M Enterprises landfill on that date,</p> <p>10-36-4(c) Sanitation, Litter (Wind blown paper and plastic bags) found along East property fence line.</p> <p>10-36-14(a) Grading & Soil Stabilization, West slopes shows signs of erosion all along slopes.</p> <p>10-36-10(a) Diversion of Surface Water, Southwest section of the closed cell area standing pooled water was detected.</p> <p>Today's inspection again found wind blown paper and plastic debris along the East fence line and the West sides of the landfill within a drainage ditch. 10-36-4(c) Remains in Violation, in addition to today's continuing Violations.</p> <p>Signs of regrading were found along the Southwest slopes of the landfill, in an attempt to correct violations. An area approximately 200 yards long X 30 yards wide had been regraded, an additional 200 yards to the North of that area remains untouched. This area has debris still sticking through the thin clay cover, bedding, rolled rugs, white goods were again found during today's inspection. 10-36-4(a) Grading & Soil Stabilization Violations remain in effect with some noted activity to correct them.</p> <p>In addition to the above previous violations, additional violations were found today during my inspection, which included the following:</p> <p>10-36-4(c) Sanitation Violation, Wind blown paper and plastic were detected on the East and West sides of the landfill. It should be noted that (2) workers were found picking-up paper near the working cell area.</p>				
Received by:	<i>J. Brown</i> 1-9-97				
				a:AA/Notes/IRCF	

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 2 of 3

IN-IRCF-8-95

Date:	01/06/97	Time:	1:00Pm	County:	Lake
Facility:	Peddeler Landfill/R & M Enterprises, Inc.				
Location:	18501 Clark Road Lovell, Indiana 46356			219-696-8905	
Permit #	45-18 or Non-permitted <input type="checkbox"/>				
Inspected by:	Robert Lamprecht- <i>[Signature]</i>				
Comments:	<p>10-36-15(a) Surface Leachate Control Violation, Leachate leaks were detected near the middle of the East and West slopes of the closed cell areas, these leaks were uncontrolled and running down grade to the bottom of the slopes and ponding.</p> <p>10-36-15(b) 50 Feet beyond SW Boundary Violation, Leachate ponding was found off site within a area measuring 100' feet long X 25' feet wide on the East side of the landfill. The Leachate pond/stream was moving towards the Southern area's of the landfill at or along the property line uncontrolled/managed. I was unable to determine the extent due to the lack of property markers.</p> <p>10-13-4(c) Permit Compliance Violation, Violation of 329 IAC 2-9-2 (b) June 13, 1995 Permit restrictions (A6), Within the materials being received at this facility this inspector found and photographed the following unauthorized debris being accepted, rolled carpeting, street sweeper brushes, tree trunks greater than 6' feet in length, paper, plastic trash bags, cardboard, white goods, and amounts of discarded household items such as toy's and auto parts.</p> <p>10-35-2(b), (1) Property Boundaries Marker Violations, Violation of June 13, 1995 Permit Approval, Item (A5.) As a result of the noted leachate violations being detected during today's inspection, this inspector was unable to determine the property boundaries as a result of the lack of required established survey stakes along the boundaries of the East and West sides of the landfill. This inspector also noted that survey stakes are also missing along the slopes of the working cell area. The landfill must establish and install boundary survey stakes within (60) days of receiving written notice of violation.</p> <p>10-36-14(a), (b) Grading and Soil Stabilization/Continuous Maintenance, This inspector had recently questioned the presents of large amounts of tree balls, and tree trunks being deposited on the clay surface of a closed cell area, a shaker box was also found near the large pile of material measuring 100' feet in diameter. As a result of this material be placed on</p>				
Received by:	<i>[Signature]</i> 1-9-97				

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 1

IN-IRCF-8-95

Date: 01/06/97 Time: 1:00PM County: LakeFacility: Reddick Landfill / J. V. Enterprises, Inc.Location: 10501 Clark Road Lowell, Indiana 46356Permit # 45-112 or Non-permitted ☐ 219-896-8905Inspected by: Robert Lamprecht *Robert Lamprecht*

Comments:

top of a closed cell, landfill management cannot perform continuous maintenance nor establish proper vegetation as required, these materials must be removed to another area where it does not impact the operations of the landfill maintenance.

Photos taken:

Received by: *J. Brown* 1-9-97

s:AA/Notes/IRCF

draft 4/12/96
Not for public viewAPPENDIX B
Restricted Waste Sites Type III
and Construction/Demolition Sites
Data Entry ChecklistFacility Name: Peddeler Landfill/R & M Enterprises, Inc Permit # 45-08

Facility Type (circle one): RWS III Construction/Demolition

Inspection Date: 01/06/97 Time: 1:00Pm Inspector: R-Lamprecht

*Please circle the data code for any violations (you can also circle the 329 IAC 10 citation and written description, but the data code must be circled)

	<u>329 IAC 10</u>	<u>Data Code</u>
<u>10-36-1 Access Control</u>		
Established Roadways	10-36-1(a)	122
Restricted Access	10-36-1(b)	123
<u>10-36-2 On-Site Roads</u>		
Passable Roads	10-36-2(a)	124
Tracking Mud	10-36-2(b)	125
Monitoring Well Access	10-36-2(c)	126
<u>10-36-3 Signs</u>	10-36-3	127
<u>10-36-4 Sanitation</u>		
Livestock Present	10-36-4(a)	128
Vectors, Dust, Odors	10-36-4(b)	129
Litter	<u>10-36-4(c)</u>	<u>130</u>
Dead Animal Disposal	10-36-4(d)	131
Outside Containers	10-36-4(e)	132
<u>10-36-5 Scavenging</u>	10-36-5	133
<u>10-36-6 Salvaging</u>		
Salvage Operations	10-36-6(a)	134
Salvage Storage	10-36-6(b)	135
<u>10-36-7 Safety Requirements</u>		
Safety Devices	10-36-7(a)	136
First Aid Kit	10-36-7(b)	137
Communication System	10-36-7(c)	138
<u>10-36-8 Records and Reports</u>		
On-Site/Up-to-Date Plans	10-36-8(a)	139
Quarterly Plot Plan	10-36-8(b)	140
Furnishing Records to IDEM	10-36-8(c)	141
Manifests (c/d sites only)	10-36-8(d)	142

(over)

Appendix B

RWS III, & Construction/Demolition Data Entry Checklist

Page 2

<u>10-36-9 Open Burning</u>	<u>329 IAC 10</u> 10-36-9	<u>Data Code</u> 143
<u>10-36-10 Diversion of Surface Water</u> Waste Deposition in Water	<u>10-36-10(a)</u> <i>Jold</i> <i>PLC</i>	144
<u>10-36-11 Cover, General Provisions</u>		
Cover Soil Type	10-36-11(a)	145
Cover Application & Maintenance/ Alternative Cover Approval	10-36-11(b)	146
<u>10-36-12 Cover</u>		
RWS III Annual 6 Inches	10-36-12(a)	147
C/D Weekly 6 Inches	10-36-12(b)	148
<u>10-36-13 Dispersal Control</u>		
Fugitive Dust	10-36-13(a)	149
Daily cover/control plan	10-36-13(b)	150
<u>10-36-14 Grading and Soil Stabilization</u>		
Continuous Maintenance	<u>10-36-14(a)</u>	151
Establish & Maintain Vegetation	<u>10-36-14(b)</u>	152
Proper Grading	10-36-14(c)	153
Vegetation Clearing	10-36-14(d)	154
<u>10-36-15 Surface Leachate Control</u>		
Surface Leachate Maintenance	<u>10-36-15(a)</u>	155
50 Feet Beyond SW Boundary	<u>10-36-15(b)</u>	156
<u>10-36-16 Leachate Disposal</u>	10-36-16	157
<u>10-36-22 Prohibition on Accepting Municipal Waste by a Construction/Demolition Site</u>		
Manifest Copy	10-36-17(a)	158
Acceptance from Transfer Station	10-36-17(b)	159
<u>10-37 RWS Types III and Construction/Demolition Sites; Closure Requirements</u>		
<u>10-37-1 Performance Standard</u>	10-37-1	160
<u>10-37-2 Final Cover RWS III</u>	10-37-2(a)	161
<u>10-37-3 Final Cover C/D Sites</u>	10-37-3	162
<u>10-13 Permit Issuance and Miscellaneous Provisions</u>		
<u>10-13-4 Permit Compliance</u>	10-13-4(c)	121

Environmental Management
Gainer Bank Building, Suite 418
504 North Broadway
Gary, IN 46402



10-36-15(a) Leachate along East slope,
looking towards the North.



10-36-15(a) Leachate leaks, uncontrolled at East
slope.



Ponding of Leachate at bottom of East slope.





Un-approved waste detected within Northwest section of working cell area, rolled rugs, furniture.




Northeast section of East slope



Southwest section of West slope after being graded



Looking to the South at East slope, over looking leachate. Violation 10-36-15(b). 10-35-2(b) Lack of boundary markers

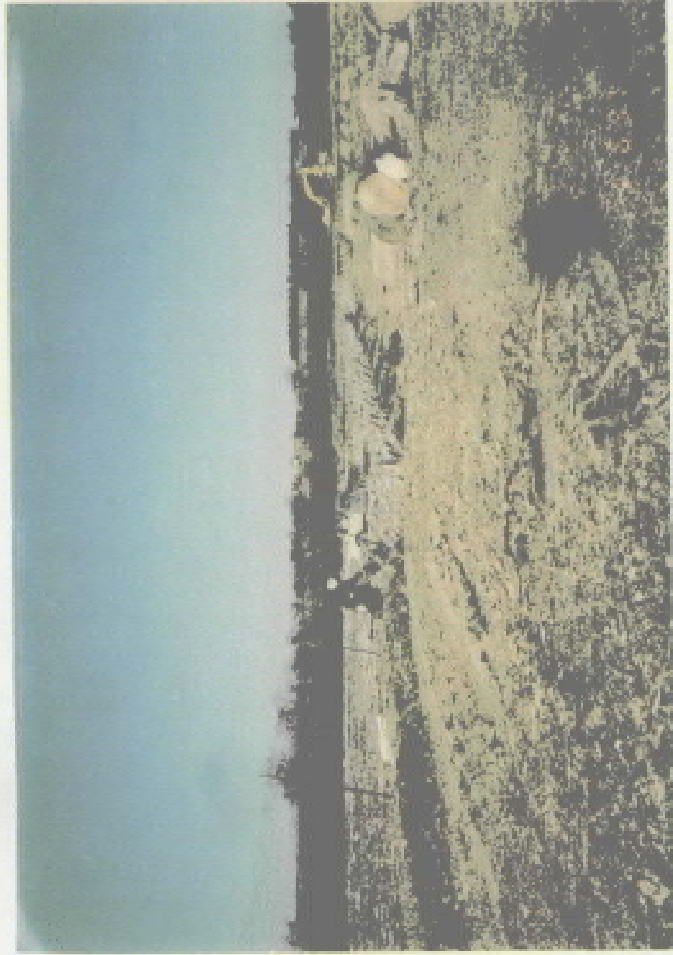

10-36-4(c) Sanitation Violation, Wind Blown Debris being picked-up by landfill workers



10-14-4(c) Permit Compliance Violation, 329 IAC 2-9-2 (b) cell area of Northern area of landfill.

Cellular area in NW 1/4 14-1A



10-14-4(b) Large brushes, rolled carpeting detected within

11-1-00 14-1A

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT
NORTHWEST REGIONAL OFFICE/GARY

INSPECTION SUMMARY

TO: Leah Foutty-OSW
Section Chief

DATE: 12/09/96

FROM: Robert Lamprecht-OSW
Compliance

SUBJECT: Feddler/R&M Enterprises Landfill Inspection 12/09/96:

This inspector conducted a routine compliance inspection on today's date and time. A list of additional concerns that were provided to the IDEM Indianapolis office, OSW. After inspecting this facility I have reviewed and verified several violations. In addition this inspector is working with Jeff Sewell and Brian Wagner in the reviewing of Feddler's operational permit, in order to determine if this landfill is operating within it's approved permit.

- 1 * Slopes, erosion and vegetation Violation found on West slopes of closed cell area, lack of vegetation due to out of season seeding period.
- 2 * Allegations of violation of setback bounties The property easement is under litigation between the landfill and Mr. Kocistra the law suit is pending in court. (Civil matter)
- 3 * Allegations of Standing Water on surface of landfill This was verified at the southwest corner of the landfill, within a closed area. The standing water is from a depression caused by the settling of the landfill. This is a Violation and was noted during my inspection.
- 4 * Allegations of water being pumped off site
(Being reviewed by this inspector and Jeff Sewell)
- 5 * Unauthorized Waste tires, Barrels, Bedding Mattress Within landfill cover a Violation was verified at west side of landfill with the discovery of a mattress. Any waste tires that are found within the loads being delivered to the landfill are being pulled from the landfill and placed in a roll off box for proper disposal. Feddler then has the waste tires hauled off.
- 6 * Allegation of failure to cover at the end of fridays activities
The landfill is covering at the end of Saturdays business due to their being open Saturdays. (Being reviewed)
- 7 * Allegations of lack of vegetative matter being established
Closed cell areas have recently been seeded, in other areas the weather has not been conducive for seeding. Violation documented.

8 • Allegation of objects sticking through surface of east slopes of landfill. Violations were verified along east slope of landfill.

9 • Allegations of off site sedimentation
(Being reviewed by this inspector and Jeff Sewell)

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 1

IN-IRCF-3-95

Date: <u>12-9-96</u>	Time: <u>12:30pm</u>	County: <u>Lake</u>
Facility: <u>Kodak's Landfill (RAM)</u>		
Location: <u>10100 West 181st Street Merrill</u>		
Permit # <u>45-08</u> or Non-permitted <input type="checkbox"/>		
Inspected by: <u>Robert Lamprecht</u>		
Comments: <u>Conducted a routine inspection on today's date & time</u> <u>this inspector found the following violations:</u>		
<u>10-28-4 Sanitation - Litter found along inside of Fence line east side</u> <u>of landfill Northeast section.</u>		
<u>Litter found within drainage ditch west side of landfill paper, plastic</u> <u>item in ditch. Mattress and other debris sticking-up through slope west side</u>		
<u>10-28-14 Grading & Soil Stabilization - West slopes show signs of erosion with</u> <u>ruts all along slopes</u>		
<u>10-29-10 Diversion of Surface Water/standing water, located near Southwest corner</u> <u>(87467) of closed cell, standing water pools found.</u>		
<u>Needed Corrections to today's violations:</u>		
* <u>Litter must be picked-up on East & West sides of landfill</u>		
* <u>Items must be removed from West slopes of landfill, items sticking-up</u> <u>through clay cover</u>		
* <u>Apply more clay soils on West slopes at bottom.</u>		
<u>Apply clay 10' low lying area at Southwest area of closed cell</u> <u>& remove surface water runoff</u>		
* <u>Waste Tires, Reusable Metals are being placed in roll-off boxes on site</u> <u>and marked</u>		
<u>Photos taken</u>		
Received by: <u>Julia A Brown</u>		

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 1

IN-IRCF-8-95

Date: 10-21-86	Time: 10:30 AM	County: LAKE
Facility: RLM Disposal-Federal		
Location: 18501 CLARK RD. Lowell		
Permit # <input checked="" type="checkbox"/> SW-251 or Non-permitted <input type="checkbox"/>		
Inspected by: Robert Campbell-Lolal Campbell		
<p>Comments: A routine inspection was conducted at the Facility. Today's inspection found the working cell located in the Northwest portion of the property were lands of C/D were being received.</p> <p>* At the Northwest section of the property where a closed cell area was located it was noted that the Area had thin cover (lack of clay). C/D could be seen sticking up with paper and wood material. Violation 10-21-12 cover # 191</p> <p>At the same area off site blowing litter was found off site from the Area. Violation 10-28-4 Sanitation # 176</p> <ul style="list-style-type: none"> - Needed corrective actions. Apply more clay to closed cell Area. (Should be done weekly) - Clean-up off site Blowing Litter. 		
Received by: <u>Julia A. Brown</u>		

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 1

IN-IRCF-8-95

Date: <u>10-21-96</u>	Time: <u>9:45 AM</u>	County: <u>LAKE</u>
Facility: <u>RLM Disposal - (Fadden's)</u>		
Location: <u>18501 CLARK ROAD. Lowell</u>		
Permit # <u>36-251</u> or Non-permitted <input type="checkbox"/>		
Inspected by: <u>Robert Lamprecht - Lake County</u>		
Comments: <u>LAST inspection was on 10-21-96, during that inspection the following violations were found.</u>		
<u>lack of clay cover at closed cell AREA Northeast sections #191 (10-28-12).</u>		
<u>Blowing Litter was also detected within this same AREA. #171 Sanitation 10-28-4.</u>		
<u>this inspector conducted a Follow-up inspection to determine if corrective Actions have taken place to these cited violations. today's inspection found some clay material had been placed within the thin cover AREA located at the Northeast cell. More clay was requested by this inspector as a result of remaining thin AREAS.</u>		
<u>Additional blowing Litter was detected during today's inspection, this was a result of high winds 25-30 mph. the landfill was instructed to take necessary Actions to prevent additional problems (Litter).</u>		
<u>(place clay of working cell on close-downs.)</u>		
<u>the owner Bob Fadden complied with all this inspector's requests.</u>		
<u>Property markers and cell location markers are being installed by Mr. Fadden.</u>		
Received by: _____		

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 1

IN-IRCF-8-95

Date: 9-16-96 Time: 1:15 PM County: LAKEFacility: R&MLocation: SR 2, 1/2 mile East Hwy 41Permit # 45-08 or Non-permitted ☐Inspected by: Wm Bras-Hubert Robert Hargrett

Comments: On the above time & date, Inspectors went to the above location to
conduct a routine inspection & follow up on any previous notice violations.

Inspectors entered the site, announced our presence to management.
The working cell was noted in the former borrow pit area at the North end
of the property. Inspectors noted a lack of cover in the North East portion of
the landfill for this being a Monday.

VIOLATION 329 IAC 10-36-12 LACK OF AT LEAST 6" OF COVER MATERIAL
THAT SHOULD BE APPLIED WEEKLY

Inspectors also noted a motorized segregating machine in the area of a large
amount of yard waste (vegetative material). It appears that some type of
processing is taking place at this facility.

Inspectors noted blowing litter in the Northern Sections of the landfill.

VIOLATION - 329 IAC 10-20-4 (C)

Also quite a bit of dust blowing around on the property
329 IAC 10-20-4 (B)

Received by:

Julia Brown

a:AA/lotus/IRCF

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 1

IN-IRCF-8-95

Date: 8-27-96	Time: 11:40Am	County: LAKE
Facility: FENDELER C/O SITE		
Location: STATE RD 2 1/2 MILE EAST 41 18501 CHARK RD LOWELL, IN.		
Permit # 46-08 or Non-permitted <input type="checkbox"/>		
Inspected by: Whitburn Thibaut		
<p>Comments: On the above time & date, this Inspector accompanied DNE representatives, MR. HARRY OSTERHOLTZ, & CASSANDRA BECKER, Along with PAUL CLINY, Soil Water Conservation District to the above site for soil stabilization check.</p> <p>This Inspector saw one item of concern. Some holes were forming in the road way from the large trucks entering & exiting. The road was watered down to reduce the amount of dust. Management said the roads would be filled & level right away.</p> <p>No other violations were observed.</p> <p>An area on the East side of the property was being seeded.</p> <p>This Inspector observed (2) two roll off boxes on top of the landfill that were being used to hold waste tires.</p>		
Received by: MAIL		

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 1 of 1

IN-IRCF-8-95

Date: 6-14-96Time: 11:05 AmCounty: LAKEFacility: FEDDELER CID SITELocation: SR 2 1/2 MILE EAST OF US 41Permit # 45-0008 or Non-permitted ☐Inspected by: Wm. S. W. W. W.Robert L. W. W. W.**Comments:**

On the above date, an inspection was conducted. Inspectors observed the following: A Compactor was operating in the working cell which was located on the South side of the landfill. A bulldozer was also working in the cell area. Some young male employees were removing pieces of metal from the debris & staging the material to put in a roll off box. Inspectors noted Garbage on the bottom of the North slope. According to management, the garbage rolled off one of the slopes during heavy rains. It is going to be cleaned off the slope & taken care of. Inspectors re-inspected the East side of the property & found no paper or debris.

329 IAC 10-36-12 COVER RESTRICTED WASTE SITE TYPE III & CID SITES
 LANDFILL MANAGEMENT IS AWARE OF PROBLEM & ABLE TO CLEAN UP
 BECAUSE OF MUD BEING SO DEEP.

Inspectors reviewed new rules with Management

Inspectors informed that management has now obtained a third
 Compactor. Management has furnished rest rooms, vending machines,
 first aid kits, water, & fire extinguishers on site.

Received by:

Paul FeddeleR & M

a: AAD/otus/IRCF

PHONE CALL

FOR Bob Lamprecht DATE 4-1-96 TIME 8:40 A.M.
 M Edward Carter (lives in Lowell)
 OF (219) 696-0976 ☒ PHONED
 PHONE Re: landfill ☒ RETURNED YOUR CALL
 MESSAGE on Rt 4 East of 41 ☒ PLEASE CALL
He thought it was supposed ☒ WILL CALL AGAIN
to be transfer station M. Mathieson ☒ CAME TO SEE YOU
 SIGNED ☒ WANTS TO SEE YOU
 SECOND NATURE™ RECYCLED TOPS FORM 74820

PHONE CALL

FOR Bob Lamprecht DATE 4-4-96 TIME 9:58 A.M.
 M Paul Schieve (pronounced SHI VEE)
 OF lives in Lowell ☒ PHONED
 PHONE (708) 596-9500X145 ☒ RETURNED YOUR CALL
 MESSAGE Re: possible landfill ☒ PLEASE CALL
west of Lowell. Wants info ☒ WILL CALL AGAIN
re: regulation permits, ☒ CAME TO SEE YOU
inspection reports etc. ☒ WANTS TO SEE YOU
Will be at about phone no. tell
M. Mathieson

PHONE CALL

FOR Bob Lamprecht DATE 4-1-96 TIME 10:15 A.M.
 M Anonymous
 OF Re: landfill
 PHONE on Rt. 2
 MESSAGE East of 41
M. Mathieson
 SIGNED ☒ SECOND NATURE™ RECYCLED TOPS FORM 74820

IMPORTANT MESSAGE

FOR B. Burns / Bob S.
 DATE 4-2 TIME 11:09 A.M.
 M Pam Kubeck
 OF (219) 696-6940
 PHONE AREA CODE NUMBER EXTENSION
☐ FAX AREA CODE NUMBER TIME TO CALL
☐ MOBILE

TELEPHONED	PLEASE CALL	<input checked="" type="checkbox"/>
CAME TO SEE YOU	WILL CALL AGAIN	
WANTS TO SEE YOU	RUSH	
RETURNED YOUR CALL	SPECIAL ATTENTION	


 MESSAGE ADSW Lake Co.
Robert W. Feddeler
drumper
 SIGNED



02 26 96



02 26 96

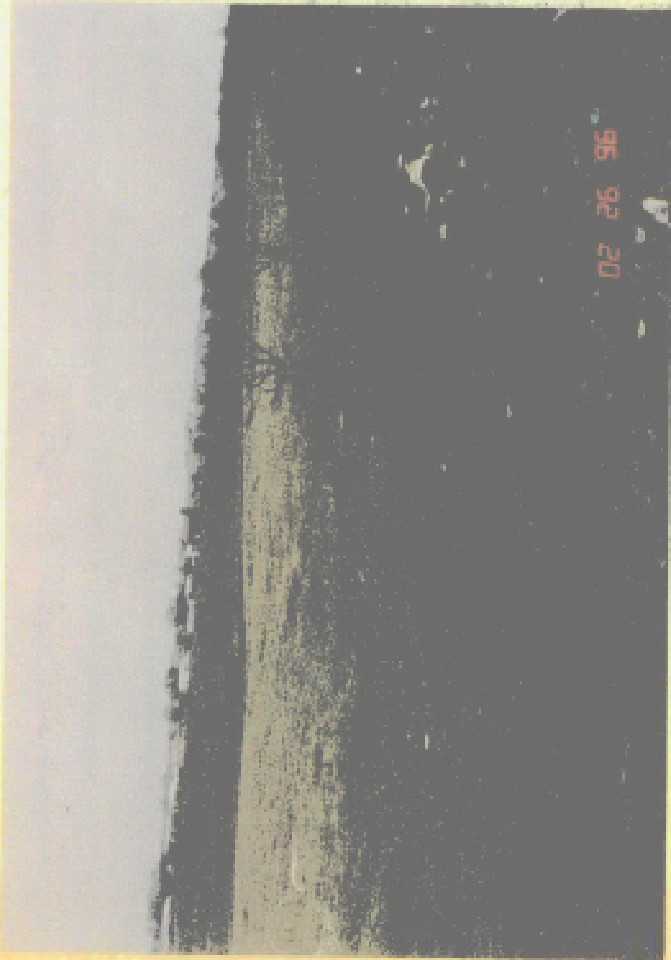

02 26 96



02 26 96

FEDDELER'S LANDFILL 18501 CLARK RD. LOWELL, IN.



COMPACTORS BEING USED AT FIDDLEBOTS

Note: (2)
Compactors at
Fiddlebots
100% Better
Operations At LF.




CONCRETE CRUSHER IN OPERATION



EAST SLOPE WHERE SEEDING IS IN PROGRESS



LACK OF COVER DOCUMENTED ON TOP OF LANDFILL

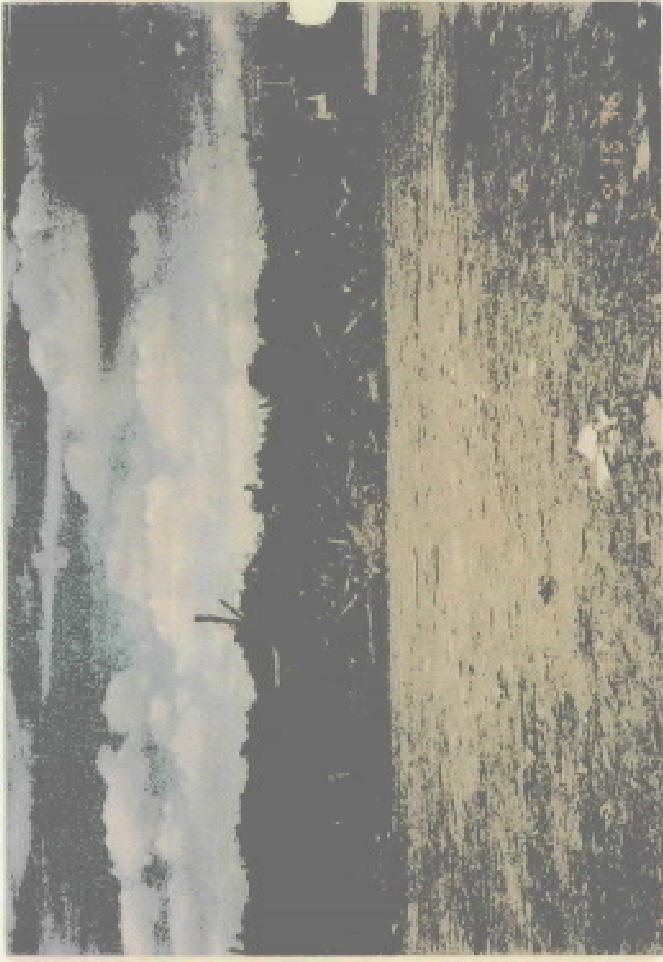

AREA OF LANDFILL WHERE YARD WASTE IS REMOVED



SEGREGATING MACHINE ON LOAN TO BE REMOVED
BECAUSE OF NO PERMIT TO OPERATE

FEDDELEES LANDFILL
R9M ENTERPRISES

**Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Facility Inspection Report**

2B1

Registrant *

Date <u>4-9-90</u>	Time <u>9:00 Am</u>	County <u>LAKE</u>
Facility <u>FEDDELER C/D SITE</u>	Permit Yes * <input checked="" type="checkbox"/>	No <u>45-08</u>
Location <u>3/2 MILE EAST OF US 41</u>	Inspected By <u>PHILIP REINHOLD</u>	
Type Of Operation:	<input type="checkbox"/> Sanitary Landfill <input checked="" type="checkbox"/> Construction/Demolition <input type="checkbox"/> Processing Facility <input type="checkbox"/> Incinerator	
	Restricted Waste Site Type _____ Collection Container _____ Other _____	

OPERATIONAL REQUIREMENTS-LAND DISPOSAL

- | | |
|---|---|
| 1. ACCESS CONTROL, 2-14-1 | 14. COVER-RWS TYPE II, 2-14-14 * |
| 2. ON-SITE ROADS, 2-14-2 | 15. COVER-RWS TYPE III, 2-14-15 * |
| 3. SIGNS, 2-14-3 | 16. COVER-CONST/DEMO SITES, 2-14-16 * |
| 4. SANITATION, 2-14-4 <input checked="" type="checkbox"/> | 17. DISPERSAL CONTROL, 2-14-17 |
| 5. SCAVENGING, 2-14-5 | 18. GRADING & SOIL STABILIZATION, 2-14-18 |
| 6. SALVAGING, 2-14-6 | 19. FINAL COVER, 2-14-19 |
| 7. SAFETY REQUIREMENTS, 2-14-7 | 20. EXPLOSIVE GASES, 2-14-20 |
| 8. RECORDS, 2-14-8 | 21. LEACHATE ON SITE, 2-14-21 |
| 9. OPEN BURNING, 2-14-9 * | 22. LEACHATE OFF SITE, 2-14-21 * |
| 10. WASTE DEPOSIT AND COMPACTION, 2-14-10 | 23. LEACHATE COLLECTION, 2-14-22 * |
| 11. DIVERSION OF SURFACE WATER, 2-14-11 | 24. LEACHATE DISPOSAL, 2-14-23 * |
| 12. COVER-GENERAL PROVISIONS, 2-14-12 * | 25. GROUNDWATER MONITORING WELLS, 2-14-24 |
| 13. COVER-SANITARY LANDFILLS
& RWS TYPE I, 2-14-13 * | 26. PERMIT DEVIATION/MODIFICATION, 2-8-11 * |

PROCESSING FACILITIES

27. FACILITY ACCESS & ROADS, 2-19-1
 28. PUBLIC HEALTH & SAFETY, 2-19-2
 29. FACILITY SANITATION, 2-19-3 *
 30. USE OF CONTINGENCY PLAN, 2-19-4
 31. SPECIAL WASTE, 2-19-5
 32. RECORDS & REPORTS, 2-19-6
 33. PERMIT DEVIATION/MODIFICATION, 2-8-11 *

INCINERATORS

34. OPERATIONAL REQUIREMENTS, 2-20-3
 35. ADDITIONAL OPERATIONAL REQUIREMENTS
& INFECTIOUS WASTE, 2-20-4

SPECIAL WASTE

36. SPECIAL WASTE DISPOSAL, 2-21-15 *

Circled asterisk items identify major violation(s) of 329 IAC 2 or IC 13-7 and shall be corrected immediately.

Comments: Conducted a routine inspection at the above location & observed water being sprayed on access Service Road from retired fire truck by member of Landfill management. Inspectors noticed some blowing paper debris within wind fencing on East side. Inspectors checked off site parameters & found no problems.

No Other Problems Detected

RECEIVED BY:

Julia A Brown

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Facility Inspection Report

2B1

Registrant #

SM

Date <u>2-26-96</u>	Time <u>9:30 AM</u>	County <u>LAKE</u>
Facility <u>FEDDELER LANDFILL</u>	Permit Yes # <u>4508</u>	No
Location <u>18501 CLARK RD, LOWELL, IN</u>	Inspected By <u>Matthew R. Lancaster</u>	
Type Of Operation:	Sanitary Landfill	<u>Construction/Demolition</u>
	Processing Facility	Incinerator
	Restricted Waste Site Type	Collection Container
		Other

OPERATIONAL REQUIREMENTS-LAND DISPOSAL

- | | |
|---|---|
| 1. ACCESS CONTROL, 2-14-1 | 14. COVER-RWS TYPE II, 2-14-14 * |
| 2. ON-SITE ROADS, 2-14-2 | 15. COVER-RWS TYPE III, 2-14-15 * |
| 3. SIGNS, 2-14-3 | 16. COVER-CONST/DEMO SITES, 2-14-16 * |
| <u>4. SANITATION, 2-14-4</u> | 17. DISPERSAL CONTROL, 2-14-17 |
| 5. SCAVENGING, 2-14-5 | 18. GRADING & SOIL STABILIZATION, 2-14-18 |
| 6. SALVAGING, 2-14-6 | 19. FINAL COVER, 2-14-19 |
| 7. SAFETY REQUIREMENTS, 2-14-7 | 20. EXPLOSIVE GASES, 2-14-20 |
| 8. RECORDS, 2-14-8 | 21. LEACHATE ON SITE, 2-14-21 |
| 9. OPEN BURNING, 2-14-9 * | 22. LEACHATE OFF SITE, 2-14-21 * |
| 10. WASTE DEPOSIT AND COMPACTION, 2-14-10 | 23. LEACHATE COLLECTION, 2-14-22 * |
| 11. DIVERSION OF SURFACE WATER, 2-14-11 | 24. LEACHATE DISPOSAL, 2-14-23 * |
| 12. COVER-GENERAL PROVISIONS, 2-14-12 * | 25. GROUNDWATER MONITORING WELLS, 2-14-24 |
| 13. COVER-SANITARY LANDFILLS
& RWS TYPE I, 2-14-13 * | 26. PERMIT DEVIATION/MODIFICATION, 2-8-11 * |

PROCESSING FACILITIES

27. FACILITY ACCESS & ROADS, 2-19-1
28. PUBLIC HEALTH & SAFETY, 2-19-2
29. FACILITY SANITATION, 2-19-3 *
30. USE OF CONTINGENCY PLAN, 2-19-4
31. SPECIAL WASTE, 2-19-5
32. RECORDS & REPORTS, 2-19-6
33. PERMIT DEVIATION/MODIFICATION, 2-8-11 *

INCINERATORS

34. OPERATIONAL REQUIREMENTS, 2-20-3
35. ADDITIONAL OPERATIONAL REQUIREMENTS
& INFECTIOUS WASTE, 2-20-4

SPECIAL WASTE

36. SPECIAL WASTE DISPOSAL, 2-21-15 *

Circled asterisk items identify major violation(s) of 329 IAC 2 or 10-13-7 and shall be corrected immediately

Comments: TODAY'S INSPECTION INDICATED C.D. BEING RECEIVED &

MANAGED IN THE WEST END OF THE LANDFILL. INSPECTORS DOCUMENTED
(8) EIGHT PIECES OF HEAVY EQUIPMENT BEING OPERATED AT THE LANDFILL
WHICH INCLUDED (2) TWO COMPACTORS. OPERATIONS OF CRUSHING
CONCRETE WERE ALSO OBSERVED. INSPECTORS WILL CHECK WITH OFFICE
OR AIR MANAGEMENT TO FIND OUT IF A PERMIT IS REQUIRED TO OPERATE
THE CRUSHER. (FUGITIVE DUST) WASTE TIRES ARE BEING MANAGED WITH
B.F.I. INSPECTORS NOTED SOME BLOWING PAPER DEBRIS WHICH WAS
BEING PICKED UP

RECEIVED BY:

P. Feddel

Page #1 of 2

5m

Indiana Department of Environmental Management		2B1
Office of Solid and Hazardous Waste Management		Registrant *
Solid Waste Facility Inspection Report		
Date <u>11-8-95</u>	Time <u>9:50 AM</u>	County <u>LAKE</u>
Facility <u>FEDDER LANDFILL/DEMOLITION</u>		Permit Yes * <u>1508</u> No
Location <u>1850 CLARK RD, LAVER, IN 46356</u>		Inspected By <u>AMIREET * BURNS</u>
Type Of Operation: Sanitary Landfill <input checked="" type="checkbox"/> Construction/Demolition Processing Facility Incinerator		
Restricted Waste Site Type _____ Collection Container _____ Other _____		
OPERATIONAL REQUIREMENTS-LAND DISPOSAL		
<div style="display: flex; flex-wrap: wrap;"> <div style="width: 50%;"> 1. ACCESS CONTROL, 2-14-1 2. ON-SITE ROADS, 2-14-2 3. SIGNS, 2-14-3 4. SANITATION, 2-14-4 5. SCAVENGING, 2-14-5 6. SALVAGING, 2-14-6 7. SAFETY REQUIREMENTS, 2-14-7 8. RECORDS, 2-14-8 9. OPEN BURNING, 2-14-9 * 10. WASTE DEPOSIT AND COMPACTION, 2-14-10 11. DIVERSION OF SURFACE WATER, 2-14-11 12. COVER-GENERAL PROVISIONS, 2-14-12 * 13. COVER-SANITARY LANDFILLS & RWS TYPE I, 2-14-13 * </div> <div style="width: 50%;"> 14. COVER-RWS TYPE II, 2-14-14 * 15. COVER-RWS TYPE III, 2-14-15 * 16. COVER-CONST/DEMO SITES, 2-14-16 * 17. DISPERSAL CONTROL, 2-14-17 18. GRADING & SOIL STABILIZATION, 2-14-18 19. FINAL COVER, 2-14-19 20. EXPLOSIVE GASES, 2-14-20 21. LEACHATE ON SITE, 2-14-21 22. LEACHATE OFF SITE, 2-14-21 * 23. LEACHATE COLLECTION, 2-14-22 * 24. LEACHATE DISPOSAL, 2-14-23 * 25. GROUNDWATER MONITORING WELLS, 2-14-24 26. PERMIT DEVIATION/MODIFICATION, 2-8-11 * </div> </div>		
PROCESSING FACILITIES		INCINERATORS
27. FACILITY ACCESS & ROADS, 2-19-1 28. PUBLIC HEALTH & SAFETY, 2-19-2 29. FACILITY SANITATION, 2-19-3 * 30. USE OF CONTINGENCY PLAN, 2-19-4 31. SPECIAL WASTE, 2-19-5 32. RECORDS & REPORTS, 2-19-6 33. PERMIT DEVIATION/MODIFICATION, 2-8-11 *		34. OPERATIONAL REQUIREMENTS, 2-20-3 35. ADDITIONAL OPERATIONAL REQUIREMENTS & INFECTIOUS WASTE, 2-20-4
		SPECIAL WASTE
		36. SPECIAL WASTE DISPOSAL, 2-21-15 *
Circled asterisk items identify major violation(s) of 329 IAC 2 or IC 13-7 and shall be corrected immediately		
Comments: <u>TODAY'S INSPECTION DOCUMENTED THE WORKING AREA LOCATED AT THE NORTH SECTION OF THE LANDFILL. INSPECTORS WALKED THE FACILITY PROPERTY IN AN ATTEMPT TO VERIFY THE WASTE STREAMS BEING BROUGHT TO THIS FACILITY. MATERIALS FROM GLOBE, CONTRACTORS DEMOLITION WAS PRESENT AT THE LANDFILL. IMPROVEMENTS IN THE OVERALL OPERATIONS OF THIS LANDFILL WERE NOTED WITH THE PRESENCE OF NEW HEAVY EQUIPMENT (5-BECCS) INCLUDING A NEW COMPACTOR. THE OFFICES HAVE BEEN REPAIRED WITH A NEW BLOG & DAILY RECORDS & OPERATIONS ARE NOW COMPUTERIZED. THE SHARPER OLD HEAVY EQUIPMENT NEAR THE FRONT GATE HAS BEEN REMOVED GIVING A CLEANER APPEARANCE.</u>		
RECEIVED BY: _____		

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Compliance-Inspection Report and Comments

Page 2 of 2

IN-IRCF-8-95

Date: 11-8-95 Time: 9:50 AM County: LAKE

Facility: FENNER LANDFILL/RIM ENTERPRISES

Location: 18501 CLARK RD, LOWELL, IN

Permit # ☐-☐ or Non-permitted ☐

Inspected by: ROBERT LANDRECHT-

[Signature]
THOMAS BURNS-THOMPSON

Comments: A CLAY STOCK PILE WAS DOCUMENTED IN THE WEST SECTION OF THE
LANDFILL. LOADS ARE BEING SCREENED BY THE LANDFILL MANAGEMENT FOR
UNPERMITTED ITEMS & IN SEVERAL PLACES, AT LEAST (3) THREE LOADS REJECTED
AT THE LANDFILL. ANY WASTE TIRES FOUND ARE BEING PLACED IN A STAGED
ROLL-OFF-BOX ON SITE, TO BE LATER DEPOSED OF UNDER WASTE TIRE
REGULATIONS. TODAY'S INSPECTION FOUND NO EVIDENCE OF PREVIOUSLY
DOCUMENTED LEACHATE COVER PROBLEMS. ACCORDING TO LANDFILL MANAGEMENT
THEY HAVE ACQUIRED PROPERTY TO THE EAST OF THE LANDFILL & ARE IN THE
PROCESS OF ACQUIRING 40 ADDITIONAL ACRES NORTH OF THE LANDFILL.

PHOTOS TAKEN

Received by:

[Signature]
Robert A. Feddeley

a:AA/Notus/IRCF

SM

Indiana Department of Environmental Management		2B1
Office of Solid and Hazardous Waste Management		Registrant *
Solid Waste Facility Inspection Report		
Date <u>8-1-95</u>	Time <u>8:30 Am.</u>	County <u>CAGO</u>
Facility <u>Feddeler Landfill</u>	Permit <u>(Yes) 45-08</u> No	
Location <u>18501 CLARK Road Lowell</u>	Inspected By <u>Robert L. Campbell</u>	
Type Of Operation:	Sanitary Landfill <u>Construction/Demolition</u> Processing Facility Incinerator	
Restricted Waste Site Type _____ Collection Container _____ Other _____		
OPERATIONAL REQUIREMENTS-LAND DISPOSAL		
<div>1. ACCESS CONTROL, 2-14-1</div> <div>2. ON-SITE ROADS, 2-14-2</div> <div>3. SIGNS, 2-14-3</div> <div>4. SANITATION, 2-14-4</div> <div>5. SCAVENGING, 2-14-5</div> <div>6. SALVAGING, 2-14-6</div> <div>7. SAFETY REQUIREMENTS, 2-14-7</div> <div>8. RECORDS, 2-14-8</div> <div>9. OPEN BURNING, 2-14-9 *</div> <div>10. WASTE DEPOSIT AND COMPACTION, 2-14-10</div> <div>11. DIVERSION OF SURFACE WATER, 2-14-11</div> <div>12. COVER-GENERAL PROVISIONS, 2-14-12 *</div> <div>13. COVER-SANITARY LANDFILLS & RWS TYPE I, 2-14-13 *</div> <div>14. COVER-RWS TYPE II, 2-14-14 *</div> <div>15. COVER-RWS TYPE III, 2-14-15 *</div> <div>16. COVER-CONST/DEMO SITES, 2-14-16 *</div> <div>17. DISPERSAL CONTROL, 2-14-17</div> <div>18. GRADING & SOIL STABILIZATION, 2-14-18</div> <div>19. FINAL COVER, 2-14-19</div> <div>20. EXPLOSIVE GASES, 2-14-20</div> <div>21. LEACHATE ON SITE, 2-14-21</div> <div>22. LEACHATE OFF SITE, 2-14-21 *</div> <div>23. LEACHATE COLLECTION, 2-14-22 *</div> <div>24. LEACHATE DISPOSAL, 2-14-23 *</div> <div>25. GROUNDWATER MONITORING WELLS, 2-14-24</div> <div>26. PERMIT DEVIATION/MODIFICATION, 2-8-11 *</div>		
PROCESSING FACILITIES		INCINERATORS
<div>27. FACILITY ACCESS & ROADS, 2-19-1</div> <div>28. PUBLIC HEALTH & SAFETY, 2-19-2</div> <div>29. FACILITY SANITATION, 2-19-3 *</div> <div>30. USE OF CONTINGENCY PLAN, 2-19-4</div> <div>31. SPECIAL WASTE, 2-19-5</div> <div>✓ 32. RECORDS & REPORTS, 2-19-6</div> <div>✓ 33. PERMIT DEVIATION/MODIFICATION, 2-8-11*</div>		<div>34. OPERATIONAL REQUIREMENTS, 2-20-3</div> <div>35. ADDITIONAL OPERATIONAL REQUIREMENTS & INFECTIOUS WASTE, 2-20-4</div>
		SPECIAL WASTE
		36. SPECIAL WASTE DISPOSAL, 2-21-15 *
Circled asterisk items identify major violation(s) of 329 IAC 2 or IC 13-7 and shall be corrected immediately.		
<p>Comments: <u>Today's inspection found the working cell on the Western side of the property. During my inspection several waste tires were detected within the landfill. These must be removed upon dumping. Waste Tires transportation forms were provided for registration. Roofing materials were also detected within the material, this must also be monitored.</u></p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>		
RECEIVED BY: <u>X Robert W Feddeler</u>		

July 6, 1995

Memo to: Laura Steadham
From: Tom Daugherty
Subject: Feddeler Landfill Survey

Dean Biddle, a neighbor of the above-referenced landfill, sent IDEM a complaint letter requesting that a height check survey be performed at the site. Per Daniela Klesmith's request, a site survey was done by Mike Cox, Mike Sonnefeld, and me on June 16, 1995. Inspector Bob Lamprecht was also there for part of the day. Attached is a site map with the results of the survey.

We found no violation of the height requirements at the Feddeler landfill. The field elevations are at or below elevations designated in the permit application map. The only points above the permit elevations are temporary soil stockpiles. It is not recommended that any further action be taken on Mr. Biddle's complaint.

However, several other things were noted during our on-site visit. The entire site is very rough in appearance, with vegetation being sparse on the side slopes of the field areas. We were there on a Friday evening - the landfill had closed for the day with no apparent attempt to apply the weekly cover on the working face. Construction/demolition waste had been stockpiled - the site was not permitted to accept this (in fact, I believe Bob Lamprecht wrote a violation notice for this while we were there). Several pieces of junk equipment were scattered here and there.

Along the east side slopes, a lot of trash was in evidence against the property line fences. In an excavated area at the northwest corner of the fill, leachate leakage was in evidence in several spots - this was running to the storm drainage sump and being pumped out to the adjacent waterways. Dust control for truck traffic was non-existent.

The sum of all this is a perception on my part that the landfill owners need to pay more attention to environmental concerns. My conversations with Bob Feddeler revealed a lot of professed ignorance on his part about permit height and general requirements (since that time, he and his engineer met with Aaron Lauster and the new C/D permit requirements were reviewed line-by-line). I would recommend that his site be inspected as often as possible - at least until we can be assured that the landfill operator is familiar with the permit requirements and displays a willingness to comply with them.

Please contact me if further information is needed.

cc: Aaron Lauster
Leah Fouty
Daniela Klesmith
Ghodrat Hiadari

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT
OFFICE OF SOLID AND HAZARDOUS WASTE
COMPLAINT REPORT

Date Received 2/5/88 Complaint Report Submitted by _____
How was complaint received? (Phone, Letter, Other) Phone
Have the allegations in this complaint been previously reported to any other agencies, officials, or persons? YES _____ NO ☒ To Whom: _____

COMPLAINANT INFORMATION

Name Ted Zagar Phone 219 3879292 H
Address Local RMA site
City/State East Chicago Zip 786 4837 W

Describe how the Complainant is aware of and/or affected by the alleged activity (e.g., employee, neighbor, etc.) Neighbor

RESPONSIBLE PARTY INFORMATION (Complete as applicable or available)

Name DANNY McCarbide (RMA)
Address _____
City East Chicago State Ind Zip _____
Exact Location of alleged activity RMA Fire St. Industrial PARK.
Railroad Ave. East Chicago Ind.

NATURE OF COMPLAINT - Describe specific allegations, quantity and types of materials involved, supporting information, when does the activity occur, how long has the activity been going on, etc.?

Mr. Zagar and other neighbors have been monitoring the activities after dark and on weekends and have noticed dumping on the site of RMA. Several community groups now involved, since no clean-up activities have started.

TRACKING INFORMATION - Entered in tracking system, yes _____ no _____ initials _____
County _____ EPA or State ID# _____
Copy made for file () _____ Filed in: _____

0996M
5/19/88
KAW

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Facility Inspection Report

2B1

Registrant #

Date <u>6-16-95</u>	Time <u>10:30 AM</u>	County <u>LAKE</u>
Facility <u>RDM Enterprises Inc / Feltedex</u>	Permit <u>(es) 45-0008</u>	No
Location <u>18501 CLARK ROAD</u>	Inspected By <u>Robert Lamprecht</u>	
Type Of Operation: <u>Sanitary Landfill</u> <u>Construction/Demolition</u> <u>Processing Facility</u> <u>Incinerator</u>		
<u>Restricted Waste Site Type</u> <u>Collection Container</u> <u>Other</u>		

OPERATIONAL REQUIREMENTS-LAND DISPOSAL

- | | |
|---|---|
| 1. ACCESS CONTROL, 2-14-1 | 14. COVER-RWS TYPE II, 2-14-14 * |
| 2. ON-SITE ROADS, 2-14-2 | 15. COVER-RWS TYPE III, 2-14-15 * |
| 3. SIGNS, 2-14-3 | 16. COVER-CONST/DEMO SITES, 2-14-16 * |
| 4. SANITATION, 2-14-4 | 17. DISPERSAL CONTROL, 2-14-17 |
| 5. SCAVENGING, 2-14-5 | 18. GRADING & SOIL STABILIZATION, 2-14-18 |
| 6. SALVAGING, 2-14-6 | 19. FINAL COVER, 2-14-19 |
| 7. SAFETY REQUIREMENTS, 2-14-7 | 20. EXPLOSIVE GASES, 2-14-20 |
| 8. RECORDS, 2-14-8 | 21. LEACHATE ON SITE, 2-14-21 |
| 9. OPEN BURNING, 2-14-9 * | 22. LEACHATE OFF SITE, 2-14-21 * |
| 10. WASTE DEPOSIT AND COMPACTION, 2-14-10 | 23. LEACHATE COLLECTION, 2-14-22 * |
| 11. DIVERSION OF SURFACE WATER, 2-14-11 | 24. LEACHATE DISPOSAL, 2-14-23 * |
| 12. COVER-GENERAL PROVISIONS, 2-14-12 * | 25. GROUNDWATER MONITORING WELLS, 2-14-24 |
| 13. COVER-SANITARY LANDFILLS
& RWS TYPE I, 2-14-13 * | 26. PERMIT DEVIATION/MODIFICATION, 2-8-11 * |

PROCESSING FACILITIES

27. FACILITY ACCESS & ROADS, 2-19-1
28. PUBLIC HEALTH & SAFETY, 2-19-2
29. FACILITY SANITATION, 2-19-3 *
30. USE OF CONTINGENCY PLAN, 2-19-4
31. SPECIAL WASTE, 2-19-5
32. RECORDS & REPORTS, 2-19-6
33. PERMIT DEVIATION/MODIFICATION, 2-8-11 *

INCINERATORS

34. OPERATIONAL REQUIREMENTS, 2-20-3
35. ADDITIONAL OPERATIONAL REQUIREMENTS
 & INFECTIOUS WASTE, 2-20-4

SPECIAL WASTE

36. SPECIAL WASTE DISPOSAL, 2-21-15 *

Circled asterisk items identify major violation(s) of 329 IAC 2-6 or IC 13-7 and shall be corrected immediately

Comments: today's inspection found the East slope graded with
Black dirt and seed applied. Cover material was being applied
to working area. A debris fence was installed on the East side
of the Landfill approx 1,500 ft was installed.

* A large pile of concrete was detected during my inspection
this is a deviation of their permit, this is a violation of
their permit # 26 is being noted on my inspection. These items
should not be transported and dumped/staged at Facility until
proper permitting action is completed

RECEIVED BY:

R. L. Stedeler



Material being dumped on site, before being used
the paper permit.

(#26 Deviation of their permit)



6-16-85

Feldman / R.M. Feldman, Inc.

45-0008

FILE

W.D.M. D.S. D.L. 1/2/85



INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT

We make Indiana a cleaner, healthier place to live.

Evan Bayh
Governor
Kathy Prosser
Commissioner

100 North Senate Avenue
P.O. Box 6015
Indianapolis, Indiana 46206-6015
Telephone 317-232-8603
Environmental Helpline 1-800-451-6027

VIA CERTIFIED MAIL Z 339 775 841

Mr. Robert Feddeler
R & M Enterprises, Inc.
18501 Clark Road
Lowell, IN 46356

June 13, 1995

*FP# 45-08 Solid Waste
Facility permit*

Dear Mr. Feddeler:

Re: Approval of Renewal and Modification of
Solid Waste Facility Permit
FP# 45-08
Feddeler Construction/Demolition Site
Lake County

The operating permit renewal application for the above-referenced facility as received on March 13, 1986 and minor modification received on January 9, 1995 have been reviewed and certified as meeting the requirements of IC 36-9-30 and IC 13-7. This permit renewal applies to the site located at SR 2, 1/2 mile East of US 41, which contains 41 acres approved for filling. Your authority to operate this facility is subject to the Solid Waste Facility Permit FP# 45-08, issued on August 7, 1981, and the terms of this letter, and the enclosures. This operating permit renewal will expire on June 1, 1997.

You are hereby notified that the Office of Solid and Hazardous Waste Management (OSHW) of the Indiana Department of Environmental Management (IDEM) has issued a modification under the authority of IC 13-7-10-5 to the Feddeler Construction/Demolition Site. This modification changes the classification of this site from a Solid Fill Site to a construction/demolition site and allows the site to accept construction/demolition waste. Since the designation of solid fill site is no longer recognized by the IDEM, the site will be referenced as the Feddeler Construction/Demolition Site. This approval does not supersede the requirements of any other agency of local, State or federal government.

SM

Indiana Department of Environmental Management
Office of Solid and Hazardous Waste Management
Solid Waste Facility Inspection Report

2B1

Registrant *

Date 5-10-95

Time 11:30 Am

County LAKE

Facility R & M Landfill

Permit Yes # 46-0008 No

Location 18501 Clark Road

Inspected By Robert Campbell-Libel City

Type Of Operation: Sanitary Landfill Construction/Demolition Processing Facility Incinerator
Restricted Waste Site Type Collection Container Other

OPERATIONAL REQUIREMENTS-LAND DISPOSAL

- | | |
|---|---|
| 1. ACCESS CONTROL, 2-14-1 | 14. COVER-RWS TYPE II, 2-14-14 * |
| 2. ON-SITE ROADS, 2-14-2 | 15. COVER-RWS TYPE III, 2-14-15 * |
| 3. SIGNS, 2-14-3 | 16. COVER-CONST/DEMO SITES, 2-14-16 * |
| 4. SANITATION, 2-14-4 | 17. DISPERSAL CONTROL, 2-14-17 |
| 5. SCAVENGING, 2-14-5 | 18. GRADING & SOIL STABILIZATION, 2-14-18 |
| 6. SALVAGING, 2-14-6 | 19. FINAL COVER, 2-14-19 |
| 7. SAFETY REQUIREMENTS, 2-14-7 | 20. EXPLOSIVE GASES, 2-14-20 |
| 8. RECORDS, 2-14-8 | 21. LEACHATE ON SITE, 2-14-21 |
| 9. OPEN BURNING, 2-14-9 * | 22. LEACHATE OFF SITE, 2-14-21 * |
| 10. WASTE DEPOSIT AND COMPACTION, 2-14-10 | 23. LEACHATE COLLECTION, 2-14-22 * |
| 11. DIVERSION OF SURFACE WATER, 2-14-11 | 24. LEACHATE DISPOSAL, 2-14-23 * |
| 12. COVER-GENERAL PROVISIONS, 2-14-12 * | 25. GROUNDWATER MONITORING WELLS, 2-14-24 |
| 13. COVER-SANITARY LANDFILLS
& RWS TYPE I, 2-14-13 * | 26. PERMIT DEVIATION/MODIFICATION, 2-8-11 * |

PROCESSING FACILITIES

27. FACILITY ACCESS & ROADS, 2-19-1
28. PUBLIC HEALTH & SAFETY, 2-19-2
29. FACILITY SANITATION, 2-19-3 *
30. USE OF CONTINGENCY PLAN, 2-19-4
31. SPECIAL WASTE, 2-19-5
32. RECORDS & REPORTS, 2-19-6
33. PERMIT DEVIATION/MODIFICATION, 2-8-11*

INCINERATORS

34. OPERATIONAL REQUIREMENTS, 2-20-3
35. ADDITIONAL OPERATIONAL REQUIREMENTS
& INFECTIOUS WASTE, 2-20-4

SPECIAL WASTE

36. SPECIAL WASTE DISPOSAL, 2-21-15 *

Circled asterisk items identify major violation(s) of 329 IAC 2 or IC 13-7 and shall be corrected immediately

Comments: During last inspection this cover was noted in central portion of landfill, #13 was noted during that inspection, today's inspection documented the application of additional top cover in areas that were thin, corrections to last noted violation were completed.

RECEIVED BY:

x Bob Fiddler

SM

Indiana Department of Environmental Management 2B1
Office of Solid and Hazardous Waste Management Registrant #
Solid Waste Facility Inspection Report

Date <u>4-28-85</u>	Time <u>11:15 AM</u>	County <u>LAKE</u>
Facility <u>R & M Enterprises Inc.</u>		Permit <u>(Res) 45-0008</u> No
Location <u>18501-CLARK Rd Lowell</u>		Inspected By <u>Robert Lamprecht</u>
Type Of Operation: Sanitary Landfill Construction/Demolition Processing Facility Incinerator <u>Restricted Waste Site Type</u> Collection Container Other _____		

OPERATIONAL REQUIREMENTS-LAND DISPOSAL

- | | |
|---|--|
| 1. ACCESS CONTROL, 2-14-1
2. ON-SITE ROADS, 2-14-2
3. SIGNS, 2-14-3
4. SANITATION, 2-14-4
5. SCAVENGING, 2-14-5
6. SALVAGING, 2-14-6
7. SAFETY REQUIREMENTS, 2-14-7
8. RECORDS, 2-14-8
9. OPEN BURNING, 2-14-9 *
10. WASTE DEPOSIT AND COMPACTION, 2-14-10
11. DIVERSION OF SURFACE WATER, 2-14-11
<u>12. COVER-GENERAL PROVISIONS, 2-14-12 *</u>
13. COVER-SANITARY LANDFILLS
& RWS TYPE I, 2-14-13 * | 14. COVER-RWS TYPE II, 2-14-14 *
15. COVER-RWS TYPE III, 2-14-15 *
16. COVER-CONST/DEMO SITES, 2-14-16 *
17. DISPERSAL CONTROL, 2-14-17
18. GRADING & SOIL STABILIZATION, 2-14-18
19. FINAL COVER, 2-14-19
20. EXPLOSIVE GASES, 2-14-20
21. LEACHATE ON SITE, 2-14-21
22. LEACHATE OFF SITE, 2-14-21 *
23. LEACHATE COLLECTION, 2-14-22 *
24. LEACHATE DISPOSAL, 2-14-23 *
25. GROUNDWATER MONITORING WELLS, 2-14-24
26. PERMIT DEVIATION/MODIFICATION, 2-8-11 * |
|---|--|

PROCESSING FACILITIES

- 27. FACILITY ACCESS & ROADS, 2-19-1
- 28. PUBLIC HEALTH & SAFETY, 2-19-2
- 29. FACILITY SANITATION, 2-19-3 *
- 30. USE OF CONTINGENCY PLAN, 2-19-4
- 31. SPECIAL WASTE, 2-19-5
- 32. RECORDS & REPORTS, 2-19-6
- 33. PERMIT DEVIATION/MODIFICATION, 2-8-11 *

INCINERATORS

- 34. OPERATIONAL REQUIREMENTS, 2-20-3
- 35. ADDITIONAL OPERATIONAL REQUIREMENTS
 & INFECTIOUS WASTE, 2-20-4

SPECIAL WASTE

- 36. SPECIAL WASTE DISPOSAL, 2-21-15 *

Circled asterisk items identify major violation(s) of 329 IAC 2-9-13, 2-9-13.2 and shall be corrected immediately.

P 215 679 945

Receipt for
Certified Mail



No Insurance Coverage Provided
Do not use for International Mail
(See Reverse)

Sent to

Robert Feddeler

Street and No.

21827 Austin

P.O., State and ZIP Code

Lowell IN 46356

Postage

\$ 32

Certified Fee

1.1

Special Delivery Fee

Restricted Delivery Fee

Return Receipt Showing
to Whom & Date Delivered

1.1

Return Receipt Showing to Whom,
Date, and Addressee's Address

TOTAL Postage
& Fees

\$ 2.52

Postmark or Date

1 Dam N11524

PS Form 3800, June 1991

**STICK POSTAGE STAMPS TO ARTICLE TO COVER FIRST CLASS POSTAGE,
CERTIFIED MAIL FEE, AND CHARGES FOR ANY SELECTED OPTIONAL SERVICES (see front).**

1. If you want this receipt postmarked, stick the gummed stub to the right of the return address leaving the receipt attached and present the article at a post office service window or hand it to your rural carrier (no extra charge).
2. If you do not want this receipt postmarked, stick the gummed stub to the right of the return address of the article, date, detach and retain the receipt, and mail the article.
3. If you want a return receipt, write the certified mail number and your name and address on a return receipt card, Form 3811, and attach it to the front of the article by means of the gummed ends if space permits. Otherwise, affix to back of article. Endorse front of article **RETURN RECEIPT REQUESTED** adjacent to the number.
4. If you want delivery restricted to the addressee, or to an authorized agent of the addressee, endorse **RESTRICTED DELIVERY** on the front of the article.
5. Enter fees for the services requested in the appropriate spaces on the front of this receipt. If return receipt is requested, check the applicable blocks in item 1 of Form 3811.
6. Save this receipt and present it if you make inquiry.

U.S. GPO: 1991-302-916

Is your RETURN ADDRESS completed on the reverse side?

SENDER:

- Complete items 1 and/or 2 for additional services.
- Complete item 3, and 4a & b.
- Print your name and address on the reverse of this form so that we can return this card to you.
- Attach this form to the front of the mailpiece, or on the back if space does not permit.
- Write "Return Receipt Requested" on the mailpiece below the article number.
- The Return Receipt will show to whom the article was delivered and the date delivered.

I also wish to receive the following services (for an extra fee):

1. ☐ Addressee's Address

2. ☐ Restricted Delivery

Consult postmaster for fee.

3. Article Addressed to:

Robert Feddeler
21827 Austin
Lowell IN 46356

RCVD
4-19

4a. Article Number
P 215 679 945

4b. Service Type

<input type="checkbox"/> Registered	<input type="checkbox"/> Insured
<input type="checkbox"/> Certified	<input type="checkbox"/> COD
<input type="checkbox"/> Express Mail	<input type="checkbox"/> Return Receipt for Merchandise

7. Date of Delivery
4-17-95

8. Addressee's Address (Only if requested and fee is paid)

5. Signature (Addressee)
Robert Feddeler

6. Signature (Agent)

UNITED STATES POSTAL SERVICE

Official Business



05.45-1

Print your name and ZIP Code here

ENVIRONMENTAL MANAGEMENT
SOLID & HAZARDOUS WASTE MANAGEMENT


100 N. Senate
P.O. Box 6015

INDIANAPOLIS, IN 46206-0015

Feddeler
Page 2

If you have any questions, please contact either Mr. Steve Schafer or Ms. Leah Foutty at 317/232-4445.

Sincerely,

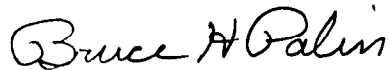A handwritten signature in cursive script that reads "Bruce H. Palin".

Bruce H. Palin, Chief
Solid Waste Branch
Solid and Hazardous Waste Management

SS:kd

Enclosure

cc: Lake County Health Department
Lake County Solid Waste Management District
Northwest Office

United States Environmental Protection Agency
Washington, DC 20460

Certification Regarding
Debarment, Suspension, and Other Responsibility Matters


The prospective participant certifies to the best of its knowledge and belief that it and its principals:

- (a) Are not presently debarred, suspended, proposed for debarment, declared ineligible, or voluntarily excluded from covered transactions by any Federal department or agency;
- (b) Have not within a three year period preceding this proposal been convicted of or had a civil judgement rendered against them for commission of fraud or a criminal offense in connection with obtaining, attempting to obtain, or performing a public (Federal, State, or local) transaction or contract under a public transaction; violation of Federal or State antitrust statutes or commission of embezzlement, theft, forgery, bribery, falsification or destruction of records, making false statements, or receiving stolen property;
- (c) Are not presently indicted for or otherwise criminally or civilly charged by a government entity (Federal, State or local) with commission of any of the offenses enumerated in paragraph (1)(b) of this certification; and
- (d) Have not within a three-year period preceding this application/proposal had one or more public transactions (Federal, State or local) terminated for cause or default.

I understand that a false statement of this certification may be grounds for rejection of this proposal or termination of the award. In addition, under 18 USC Sec. 1001, a false statement may result in a fine of up to \$10,000 or imprisonment for up to 5 years, or both.

LARRY PURLEE, VICE-PRESIDENT

Typed Name & Title of Authorized Representative

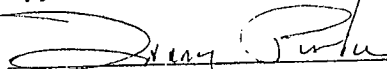

NOVEMBER 21, 2006

Signature of Authorized Representative

Date

REYNOLDS INLINER, LLC

☐ I am unable to certify the above statements. My explanation is attached.

P 749 694 55



Certified Mail Receipt

No Insurance Coverage Provided

Do not use for International Mail

(See Reverse)

Sent to

Edward Feddeler

Street & No.

21827 Austin St.

P.O., State & ZIP Code

Lowell, IN 46356

Postage

Certified Fee

Special Delivery Fee


Restricted Delivery Fee

Return Receipt Showing
to Whom & Date Delivered

Return Receipt Showing to Whom
Date, & Address of Delivery

TOTAL Postage
& Fees

Postmark or Date

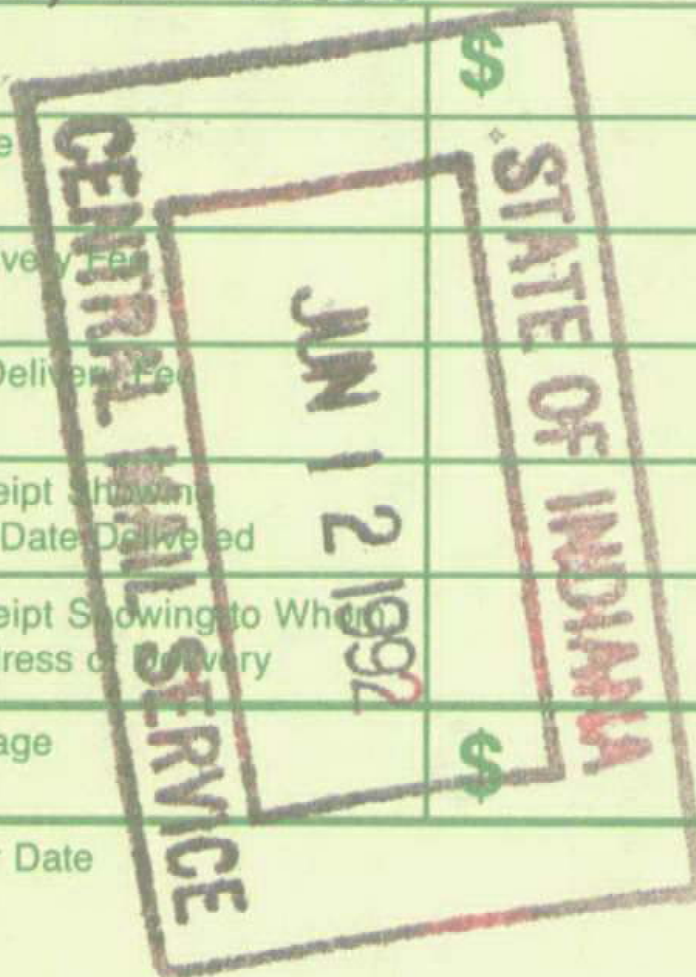

PS Form 3800, June 1990

**STICK POSTAGE STAMPS TO ARTICLE TO COVER FIRST CLASS POSTAGE,
CERTIFIED MAIL FEE, AND CHARGES FOR ANY SELECTED OPTIONAL SERVICES (see front).**

1. If you want this receipt postmarked, stick the gummed stub to the right of the return address leaving the receipt attached and present the article at a post office service window or hand it to your rural carrier (no extra charge).
2. If you do not want this receipt postmarked, stick the gummed stub to the right of the return address of the article, date, detach and retain the receipt, and mail the article.
3. If you want a return receipt, write the certified mail number and your name and address on a return receipt card, Form 3811, and attach it to the front of the article by means of the gummed ends if space permits. Otherwise, affix to the back of article. Endorse front of article **RETURN RECEIPT REQUESTED** adjacent to the number.
4. If you want delivery restricted to the addressee, or to an authorized agent of the addressee, endorse **RESTRICTED DELIVERY** on the front of the article.
5. Enter fees for the services requested in the appropriate spaces on the front of this receipt. If return receipt is requested, check the applicable blocks in item 1 of Form 3811.

6. Save this receipt and present it if you make inquiry.

☆ U.S.G.P.O. 1990-270-153

SS-Kd

SENDER:

- Complete item 1 and/or 2 for additional services.
- Complete items 3, 4a & b.
- Print your name and address on the reverse of this form so that we can return this card to you.
- Attach this form to the front of the mailpiece, or on the back if space does not permit.
- Write "Return Receipt Requested" on the mailpiece below the article number.
- The Return Receipt Fee will provide you the signature of the person delivered to and the date of delivery.

3. Article Addressed to:

Mr. Edward Feddeler
21827 Austin St.
Lowell, IN 46356

66-11

4a. Article Number

P 749 694 554

4b. Service Type

- ☐ Registered ☐ Insured
☐ Certified ☐ COD
☐ Express Mail ☐ Return Receipt for Merchandise

7. Date of Delivery

6-5-92

5. Signature (Addressee)

Edward Feddeler

6. Signature (Agent)

I wish to receive the following services (for an extra fee):

1. ☐ Addressee's Address
2. ☐ Restricted Delivery

Consult postmaster for fee.

8. Addressee's Address (Only if requested and fee is paid)

UNITED STATES POSTAL SERVICE

Official Business

GARY, IN

46401

DEPT

92

2



PERMIT NO. 1000
GARY, IN
POST OFFICE BOX 1000
GARY, IN 46401-1000
FIRST CLASS
NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES
USE, \$300

Print your name, address and ZIP Code here

105-45

DEPARTMENT OF

ENVIRONMENTAL MANAGEMENT

SOLID & HAZARDOUS WASTE MANAGEMENT

105 South Meridian Street

P.O. Box 6015

INDIANAPOLIS, IN 46206-6015

PS Form 3800, June 1990

Certified Mail Receipt
No Insurance Coverage Provided
Do not use for International Mail
(See Reverse)

UNITED STATES
POSTAL SERVICE

TM



Sent to

Edward Feddeler

Street & No.

21827 Austin

P.O., State & ZIP Code

Lowell, IN 46356

Postage

\$

Certified Fee

Special Delivery Fee

Restricted Delivery Fee

Return Receipt Showing
to Whom & Date Delivered

Return Receipt Showing to Whom,
Date, & Address of Delivery

TOTAL Postage

& Fees

\$

Postmark or Date

**STICK POSTAGE STAMPS TO ARTICLE TO COVER FIRST CLASS POSTAGE,
CERTIFIED MAIL FEE, AND CHARGES FOR ANY SELECTED OPTIONAL SERVICES (see front).**

1. If you want this receipt postmarked, stick the gummed stub to the right of the return address leaving the receipt attached and present the article at a post office service window or hand it to your rural carrier (no extra charge).
2. If you do not want this receipt postmarked, stick the gummed stub to the right of the return address of the article, date, detach and retain the receipt, and mail the article.
3. If you want a return receipt, write the certified mail number and your name and address on a return receipt card, Form 3811, and attach it to the front of the article by means of the gummed ends if space permits. Otherwise, affix to the back of article. Endorse front of article **RETURN RECEIPT REQUESTED** adjacent to the number.

4. If you want delivery restricted to the addressee, or to an authorized agent of the addressee, endorse **RESTRICTED DELIVERY** on the front of the article.
5. Enter fees for the services requested in the appropriate spaces on the front of this receipt. If return receipt is requested, check the applicable blocks in item 1 of Form 3811.
6. Save this receipt and present it if you make inquiry.

☆ U.S.G.P.O. 1990-270-153

SH/KD 65-45

SENDER:

- Complete items 1 and 2 for additional services.
- Complete items 3, a, and b.
- Print your name and address on the reverse of this form so that we can return this card to you.
- Attach this form to the front of the mailpiece, or on the back if space does not permit.
- Write "Return Receipt Requested" on the mailpiece below the article number.
- The Return Receipt Fee will provide you the signature of the person delivered to and the date of delivery.

I also wish to receive the following services (for an extra fee):

1. ☐ Addressee's Address
2. ☒ Restricted Delivery

Consult postmaster for fee.

3. Article Addressed to:

Edward Feddeler
21827 Austin
Lowell, IN 46356

4a. Article Number

P 846 723 534

4b. Service Type

- ☐ Registered ☐ Insured
- ☐ Certified ☐ COD
- ☐ Express Mail ☐ Return Receipt for Merchandise

7. Date of Delivery

2-13-92

5. Signature (Addressee)


Janette Meszard

6. Signature (Agent)

8. Addressee's Address (Only if requested and fee is paid)

UNITED STATES POSTAL SERVICE

Official Business

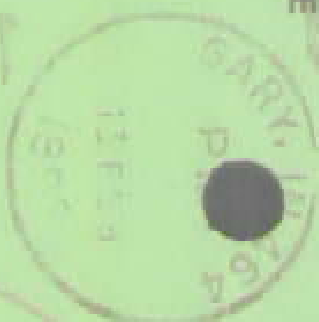

PENALTY FOR PRIVATE
USE, \$300

Print your name, address and ZIP Code here

605-45

DEPARTMENT OF

ENVIRONMENTAL MANAGEMENT

SOLID & HAZARDOUS WASTE MANAGEMENT

105 South Meridian Street

P.O. Box 6015

INDIANAPOLIS, IN 46206-6015

